
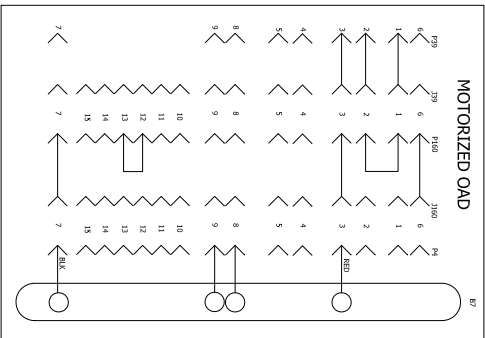


P VOLT	KW	HE1	HE2	HE3
048,060	5	5		
930	7.5	7.5	5	
15	15		7.5	
22.5	7.5		7.5	

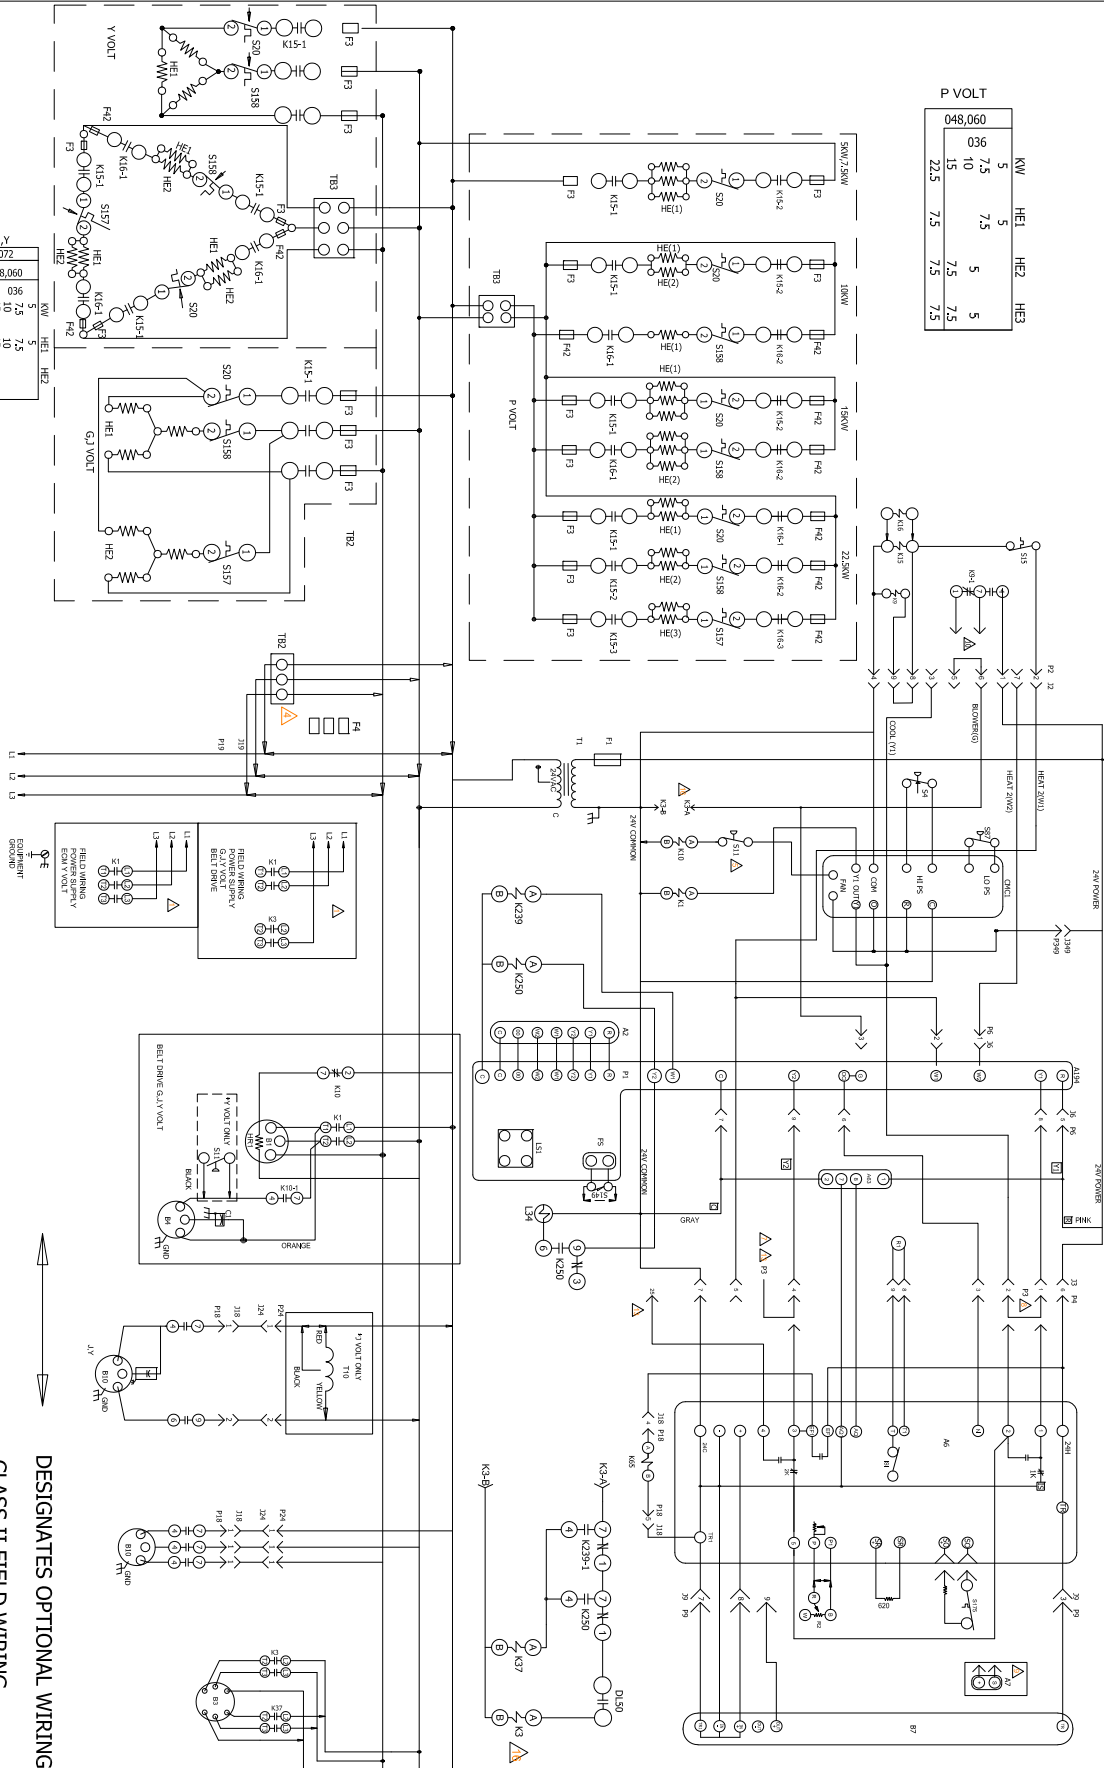

- NOTE - FOR USE WITH COPPER CONDUCTORS ONLY. REFER TO UNIT RATING PLATE FOR MINIMUM CABLE SIZE AND MAXIMUM OVERCURRENENT PROTECTION SIZE.
- IMPORTANT: TO PREVENT MOTOR BURNOUT, NEVER CONNECT MORE THAN ONE MOTOR LEAD TO ANY ONE CONNECTION. TAPE UNUSED MOTOR LEADS
- ELECTRIC HEAT FIELD OPTION.
- LOW AMBIENT KIT
- THERMOSTAT/SENSOR SUPPLIED BY USER
- REMOVE P3 WHEN ECONOMIZER OR OADM IS USED
- TIME CLOCK CONTACTS (OPT) CLOSED OCCUPIED
- A6 ETH/TAPE SENSOR MAY BE USED INSTEAD OF S1S7
- TEMPERATURE SWITCH AND RESISTOR
- REMOVE P2 WHEN ELECTRIC HEAT IS USED.
- ZCD 036, 048, 060 MODELS ONLY- G.J.Y VOLT
- K3 IS FOR BELT DRIVE UNITS ONLY

DESIGNATES OPTIONAL WIRING
CLASS II FIELD WIRING

2025/05

538559-01

WIRING DIAGRAM

05/25

COOLING-MSAV-2 SPEED	
ZCD-074	
SECTION B	REV A
Supersedes 538305-01	New Form No. 538559-01